

IMMOBILIZER SYSTEM (Except U, BR type)

When the system (ECM) enters the diagnostic mode from the registration mode:

BLINKING PATTERN	SYMPTOM	PROBLEM	PROCEDURE
<p>The diagram shows a pulse train starting with a long pulse labeled 'ON' and a gap labeled 'OFF'. A double-headed arrow below the gap indicates a duration of 10 seconds. This is followed by a series of four shorter pulses.</p>	Registration is overlapped.	The key is already registered properly.	Use a new key or cancelled key.
<p>The diagram shows a long pulse followed by a gap, then a series of four shorter pulses.</p>	Code signals cannot send or receive.	Communication fails.	Follow the troubleshooting (page 20-9).
<p>The diagram shows a long pulse followed by a gap, then a series of four shorter pulses.</p>	Registration is impossible	The key is already registered on the other system.	Use a new key.